

Data Download SW



Hand-held Ultrasonic Flowmeter IFX-P200

IFX-P 200 Data Download using USB cable

How to download data using the USB converter cable

Keep your IFX-P200 flow meter, the ISOFLUX+ software USB or CD version 4.0.000.5 and the black USB converter cable ready.


Insert the USB Key or CD with ISOFLUX+ into your computer. Open the folder of your USB key or CD drive. Double-click the *ISOFLUX+* software installer and follow the instructions to complete the installation.

Leave the USB key or CD inserted in the PC.

Connect the USB cable to the flow meter and plug it into the USB socket of your computer. A Windows message similar to the one below should occur:



This message should then turn into one similar as below:

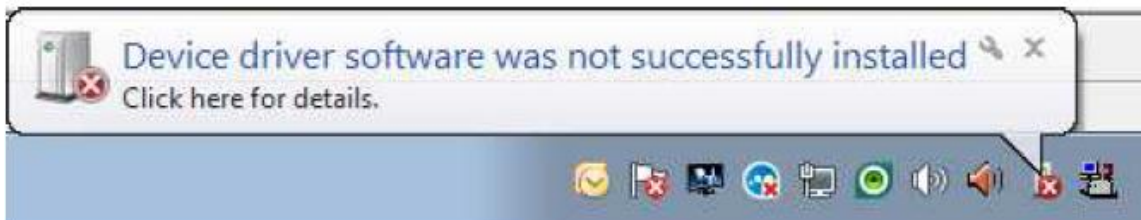

Now go to *Start*, open *Control Panel* and start the *Device Manager*. Alternatively, search for the *Device Manager* in the search field of your Windows version.

In the *Device Manager* double-click *ISOFLUX+ Data Cable* as found under *Other devices* to open a new window.

In this new window click on *Update Driver...* and select *Browse my computer for driver software*.

Select your USB key or CD drive as source of the driver and confirm that you would like to go ahead with the installation.

You will be prompted that the installation has been successful.

Go back to your *Device Manager* window. The *ISOFLUX+ Data Cable* should now be listed under *Universal Serial Bus controllers*.

Now double-click on *USB Serial Port* as found under *Other devices* to open a new window. In this new window click on *Update Driver...* and select *Browse my computer for driver software*.

Select your CD drive as source of the driver and confirm that you would like to go ahead with the installation.

You will be prompted that the installation has been successful.

Now start ISOFLUX+ and turn on the flow meter with the *Main Menu* displayed on its screen. In ISOFLUX+ go to *Options – Preferences* and select the *Serial* tab under *Serial Port* select ISOFLUX+ *Serial Port (COM...)*.

Confirm with OK.

Now press the white down-pointing arrow in the top left corner of the ISOFLUX+ software to start the download procedure.



Select a location for the file to be saved and name the file. Press *Save* to start the download. On successful connection, the flow meter will emit a beeping noise and the download will start. A download status bar will occur on ISOFLUX+ and the flow meter screen. On successful completion of the download the measurement data can be viewed in the software window.